



© Kawasaki Motors Corp., U.S.A. 1975



SERVICE INFORMATION

PROBLEM: Neutral Positioning Bolt Boss Too Short

The 1976 KH500 has a neutral positioning bolt on the upper crankcase. On some early KH500's, the positioning bolt boss was machined too short. Installation of the positioning bolt and pin in a short boss may interfere with normal gear changing.

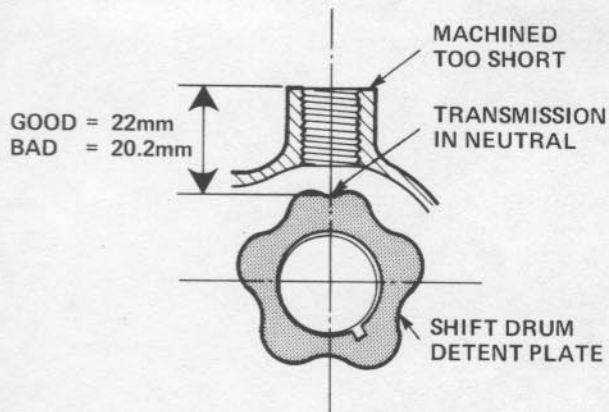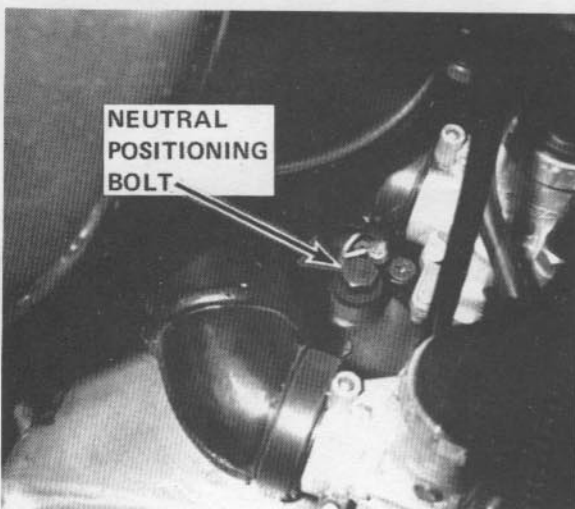


FACTORY ACTION: Installed Extra Gasket and Washer

All affected units have an added gasket and washer under the neutral positioning bolt.

DEALER ACTION: When Servicing Affected Units, Reinstall Added Parts

Check for the added parts any time the neutral positioner is removed, or whenever a customer complains of shifting problems on an affected unit.

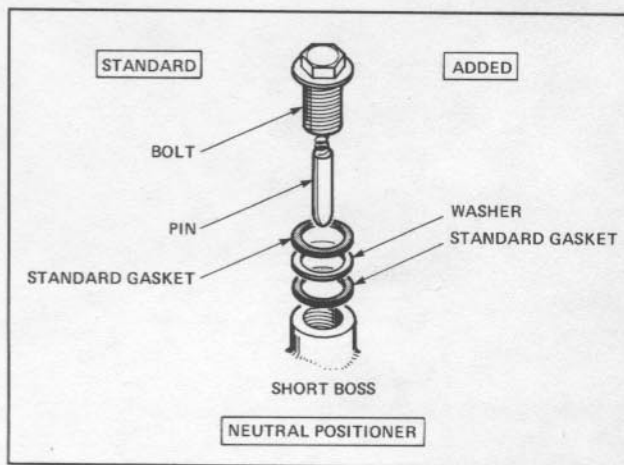

PARTS INFORMATION:

DESCRIPTION	PART NO.	THICKNESS	REMARKS	EFFECTIVE I.D.
Washer, Plain	92022-053	0.8mm	Used as a set to raise neutral positioning bolt.	E/N KAE119404 ~ KAE 119631
Gasket	92065-090	1.0mm		

WARRANTY INFORMATION.

This Bulletin is service information only, not warranty information. Use normal warranty procedures.