

# KAWASAKI SERVICE

DISC BRAKE MODELS

2/GEN-6

Kawasaki

PAD INSTALLATION

May 6, 1977

1977 Kawasaki Motors Corp. U.S.A.

PAGE 1 OF 1



## SERVICE INFORMATION


### BACKGROUND:

The front disc brakes of all of the models listed below have a shim behind pad "A". The shim loads the trailing edge of the pad to help prevent brake squeal. However, if the pad is installed incorrectly, the shim will cause excessive squeal.


S2-A  
S3-A  
KH400-A4  
H1-D  
H2-A

### DEALER ACTION:

If a disc brake squeals, check that the pads are installed properly, as shown. When replacing pads, be sure the shim is toward the front of the motorcycle.

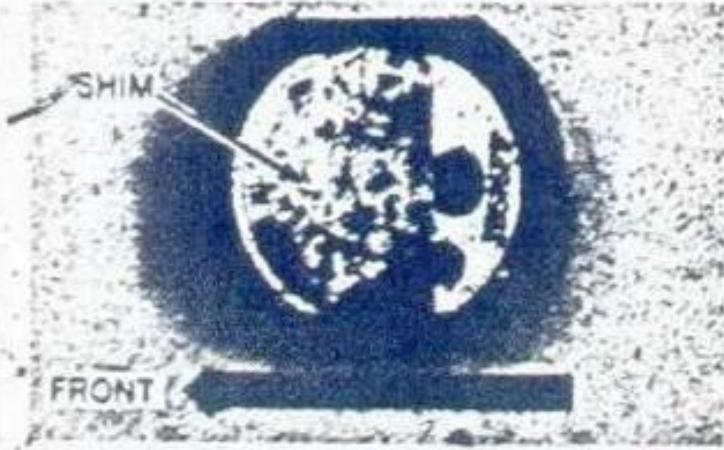

When installing the 1977 model pads in 1976 models (see Parts Bulletin 77-03), be sure to remove the spacers on the end of the caliper piston. Again, pad "A" must be installed with the shim toward the front of the motorcycle.

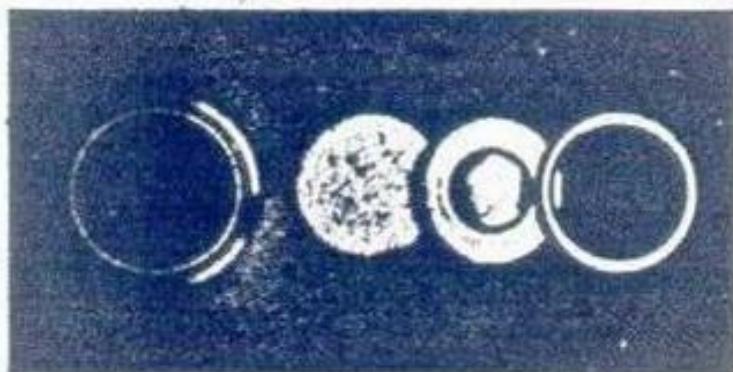

### WARRANTY INFORMATION:

This bulletin is service information only, not warranty authorization.