



## IMPORTANT NOTICE

### PROBLEM:

On some H1E's between Frame Numbers H1F-025000 and H1F-030300 there may be a brake fluid leak around the allen bolt on the bottom of the steering stem.

### SOLUTION:

- 1) Tighten this allen bolt on all affected H1E's to 3.0 kg-m (22 ft-lb).
- 2) If the bolt was loose, or if there are signs of brake fluid leakage, check brake lever operation and master cylinder brake fluid level.
- 3) If the brake lever is soft or if fluid level is low, bleed the brake system. Refer to H Series Shop Manual, Page 78.



TIGHTEN TO  
3.0 kg-m  
(22 ft-lb)

### WARRANTY INFORMATION:

This Bulletin is for service information only, not for warranty authorization.